



# Blue Gecko *Bluetooth*® Low Energy SoC EFR32BG21 Errata



---

This document contains information on the EFR32BG21 errata. The latest available revision of this device is revision B.

For errata on older revisions, refer to the errata history section for the device. The revision information is typically specified in or near the trace code on the device. Refer to the package marking information in the data sheet for more information.

Errata effective date: April, 2019.

## 1. Active Errata Summary

These tables list all known errata for the EFR32BG21 and all unresolved errata in revision B of the EFR32BG21.

**Table 1.1. Errata History Overview**

Designator	Title/Problem	Exists on Revision:	
		A	B
CUR_E301	AVDD/IOVDD to DVDD Leakage Current	X	—
GPIO_E301	GPIO_PORTA_MODEL_MODE2 Write Affects SWDIO Pin During Active Debug	X	—
GPIO_E302	Increased Leakage Current When EM4WU Pins Are Enabled and the Pin State Is High	X	X
HFXO_E301	HFXO DISONDEMAND and FORCEEN Can Cause Device to Hang	X	X
I2C_E301	New Transfer Ignored if Bus Idle Timeout Occurs Between Start Detection and the Falling Edge of SCL	X	—
I2C_E302	Slave Holds SCL Low After Losing Arbitration	X	—
IADC_E301	Delta Sigma Modulator is Disabled in KEEPWARM Mode	X	—
IADC_E302	EM23ABORTERROR Interrupt Does Not Work	X	—
IADC_E303	Input Change Missed After Adjacent GND Conversions	X	—
IADC_E304	Possible Data Loss in EM2/EM3	X	X

**Table 1.2. Active Errata Status Summary**

Errata #	Designator	Title/Problem	Workaround	Affected Revision	Resolution
			Exists		
1	GPIO_E302	<a href="#">Increased Leakage Current When EM4WU Pins Are Enabled and the Pin State Is High</a>	Yes	B	—
2	HFXO_E301	<a href="#">HFXO DISONDEMAND and FORCEEN Can Cause Device to Hang</a>	Yes	B	—
3	IADC_E304	<a href="#">Possible Data Loss in EM2/EM3</a>	Yes	B	—

## 2. Detailed Errata Descriptions

### 2.1 GPIO\_E302 – Increased Leakage Current When EM4WU Pins Are Enabled and the Pin State Is High

<b>Description of Errata</b>
When any of the EM4WU pins are used with the input path enabled and the pin state is high, an extra leakage current of approximately 15 µA per pin will be observed in EM0, EM1, EM2, and EM3.
<b>Affected Conditions / Impacts</b>
EM0, EM1, EM2, and EM3 current will be higher by approximately 15 µA per pin when any of the EM4WU pins are used with the input path enabled and the pin state is high.
<b>Workaround</b>
<p>There are two workarounds for this issue:</p> <ol style="list-style-type: none"> <li>1. If the input path on the pad is not required, disable the input path on that pad by setting the DINDIS or DINDISALT bits in the GPIO_PORTx_CTRL register. Thus, an EM4WU pin can still be used to drive an output without incurring the extra current leakage when the pin is configured as an output and DINDIS or DINDISALT is set.</li> <li>2. If an input path is required (i.e. MODEN is any value other than DISABLED and DINDIS = 0 or DINDISALT = 0), assign it to a pin which does not have EM4 wakeup capability.</li> </ol> <p>Refer to the device data sheet to determine which pins have or do not have EM4 wake-up functionality.</p>
<b>Resolution</b>
There is currently no resolution for this issue.

### 2.2 HFXO\_E301 — HFXO DISONDEMAND and FORCEEN Can Cause Device to Hang

<b>Description of Errata</b>
When DISONDEMAND and FORCEEN in the HFXO_CTRL register are both 1, the HFXO causes a handshake between the EMU and the CMU to hang, which may prevent a system reset from being asserted.
<b>Affected Conditions / Impacts</b>
The device will hang waiting for the EMU/CMU handshake to complete, requiring a pin reset to recover.
<b>Workaround</b>
Do not set DISONDEMAND = 1 in HFXO_CTRL while the HFXO is enabled.
<b>Resolution</b>
There is currently no resolution for this issue.

## 2.3 IADC\_E304 – Possible Data Loss in EM2/EM3

<b>Description of Errata</b>
When the IADC wakes from EM2 or EM3 and generates conversion results that the LDMA transfers to RAM, it is possible under very rare circumstances to lose data when the ratio of the bus clock (HCLK) is slow compared to the prescaled IADC clock (ADC_CLK).
<b>Affected Conditions / Impacts</b>
Data from IADC conversions in these cases can potentially be lost due to FIFO overflow.
<b>Workaround</b>
<p>To prevent data loss when the IADC awakens from EM2 or EM3 and performs conversions that are serviced by the LDMA before re-entering the low-energy state, make sure that:</p> <ul style="list-style-type: none"> <li>the rate at which the IADC takes samples in EM2 or EM3 is less than or equal to 125 kHz (samples are taken no faster than every 8 <math>\mu</math>s), and</li> <li>the frequency of the HCLK (bus clock) is at least four times the frequency of the IADCCLK.</li> </ul>
<b>Resolution</b>
There is currently no resolution for this issue.

### 3. Errata History

This section contains the errata history for EFR32BG21 devices.

For errata on the latest revision, refer to the beginning of this document. The device data sheet explains how to identify chip revision, either from package marking or electronically.

#### 3.1 Errata History Summary

This table lists all resolved errata for the EFR32BG21.

**Table 3.1. Errata History Status Summary**

Errata #	Designator	Title/Problem	Workaround Exists	Affected Revision	Resolution
1	CUR_E301	AVDD/IOVDD to DVDD Leakage Current	Yes	A	B
2	GPIO_E301	GPIO_PORTA_MODEL_MODE2 Write Affects SWDIO Pin During Active Debug	Yes	A	B
3	I2C_E301	New Transfer Ignored if Bus Idle Timeout Occurs Between Start Detection and the Falling Edge of SCL	Yes	A	B
4	I2C_E302	Slave Holds SCL Low After Losing Arbitration	Yes	A	B
5	IADC_E301	Delta Sigma Modulator is Disabled in KEEPWARM Mode	Yes	A	B
6	IADC_E302	EM23ABORTERROR Interrupt Does Not Work	No	A	B
7	IADC_E303	Input Change Missed After Adjacent GND Conversions	Yes	A	B

#### 3.2 Detailed Errata Descriptions

##### 3.2.1 CUR\_E301 – AVDD/IOVDD to DVDD Leakage Current

<b>Description of Errata</b>
Leakage from AVDD or IOVDD to DVDD is present when either supply voltage is higher than DVDD.
<b>Affected Conditions / Impacts</b>
When the AVDD or IOVDD supply voltage is higher than DVDD, a leakage current from AVDD or IOVDD to DVDD is present. This current has a diode like property, such that when the voltage difference is less than 700 mV, the leakage is less than 1 $\mu$ A. If the difference is near the maximum (e.g. AVDD = 3.8V and DVDD = 1.8V), the leakage can be as high as 100 $\mu$ A on a typical device at room temperature. In this case, there is also as much as 50 $\mu$ A of added current from AVDD or IOVDD directly to ground.
<b>Workaround</b>
<p>Enable the AVDD and/or IOVDD brownout detector via the EMU_BOD3SENSE register for the supply voltage(s) that is/are higher than DVDD.</p> <ul style="list-style-type: none"> <li>• Enable the AVDD monitor by performing a read-modify-write operation on the EMU_BOD3SENSE with 0x1 as the bit mask.</li> <li>• Enable the IOVDD monitor by performing a read-modify-write operation on the EMU_BOD3SENSE with 0x6 as the bit mask.</li> </ul> <p>Note that enabling the relevant brownout detector minimizes this leakage current, but it does not eliminate it completely.</p>
<b>Resolution</b>
This issue is resolved in revision B devices.

**3.2.2 GPIO\_E301 – GPIO\_PORTA\_MODEL\_MODE2 Write Affects SWDIO Pin During Active Debug**

<b>Description of Errata</b>
<p>When a debugger is connected to the device, software cannot clear GPIO_DBGROUTE PEN in order to prevent loss of communication with the host.</p> <p>However, changing the GPIO_PORTA_MODEL_MODE2 field, which corresponds to the SWDIO pin, to any of the wired-AND/wired-OR modes, effectively disables the debugger connection.</p>
<b>Affected Conditions / Impacts</b>
Reconfiguring the SWDIO pin to a wired-AND/wired-OR output mode causes loss of debugger contact upon writing to the GPIO_PORTA_MODEL_MODE2 field.
<b>Workaround</b>
To prevent the debugger from losing its connection to the target device, do not change the state of the GPIO_PORTA_MODEL_MODE2 field.
<b>Resolution</b>
This issue is resolved in revision B devices.

**3.2.3 I2C\_E301 – New Transfer Ignored if Bus Idle Timeout Occurs Between Start Detection and the Falling Edge of SCL**

<b>Description of Errata</b>
If a bus idle timeout occurs between detection of a start condition and the falling edge of SCL, the start condition detection logic is defeated, causing the I <sup>2</sup> C state machine to indicate that bus is not busy (I2C_STATE_BUSY = 0).
<b>Affected Conditions / Impacts</b>
A transfer that meets the timing conditions cited above will be missed, causing the device not to respond to the master if it is the slave being addressed. Furthermore, because I2C_STATE_BUSY no longer reflects the actual state of the bus, the device can, if configured as a master, mistakenly attempt to use the bus, thus corrupting a transfer already in progress.
<b>Workaround</b>
<p>To avoid corrupting bus activity, application software should implement the following before starting a transaction in systems where the bus timeout is used:</p> <ul style="list-style-type: none"> <li>• Wait for the I2C_IF_SSTOP flag, either by polling or by using the associated interrupt (I2C_IEN_SSTOP).</li> <li>• Impose a system-defined delay after all transfers that are independent of the bus timeout monitor to ensure that the bus is in idle state.</li> </ul> <p>When one of the above workarounds is met, the bus can be considered inactive and available for use.</p>
<b>Resolution</b>
This issue is resolved in revision B devices.

### 3.2.4 I2C\_E302 – Slave Holds SCL Low After Losing Arbitration

<b>Description of Errata</b>
If, while transmitting data as a slave, arbitration is lost, SCL is unintentionally held low for an indefinite period of time.
<b>Affected Conditions / Impacts</b>
The winner of arbitration cannot use the bus because SCL is never released.
<b>Workaround</b>
If the I <sup>2</sup> C arbitration lost flag is asserted (I2C_IF_ARBLOST = 1) in slave mode (I2C_STATE_MASTER = 0), application software needs to wait for at least one SCL high time and then issue the transmission abort command (set I2C_CMD_ABORT = 1), thus releasing SCL.
<b>Resolution</b>
This issue is resolved in revision B devices.

### 3.2.5 IADC\_E301 – Delta Sigma Modulator is Disabled in KEEPWARM Mode

<b>Description of Errata</b>
When IADC_CTRL_WARMUPMODE = KEEPWARM, the IADC delta sigma modulator is disabled between conversions.
<b>Affected Conditions / Impacts</b>
Because the delta sigma modulator is disabled before conversions restart, the results will be erroneous until the usual 1 µs required for warm-up has elapsed.
<b>Workaround</b>
Do not use IADC_CTRL_WARMUPMODE = KEEPWARM or discard the results received during the first 1 µs of operation after re-starting the converter.
<b>Resolution</b>
This issue is resolved in revision B devices.

### 3.2.6 IADC\_E302 – EM23ABORTERROR Interrupt Does Not Work

<b>Description of Errata</b>
When IADC_IEN_EM23ABORTERROR = 1, the IADC does not request an interrupt upon EM2 or EM3 entry when running from a clock that is not active in these energy modes.
<b>Affected Conditions / Impacts</b>
There is no way for the IADC to let application software know that the system has (erroneously) entered EM2 or EM3 with a converter clock source that is now disabled.
<b>Workaround</b>
There is currently no workaround for this issue.
<b>Resolution</b>
This issue is resolved in revision B devices.

### 3.2.7 IADC\_E303 – Input Change Missed After Adjacent GND Conversions

<b>Description of Errata</b>
If the IADC is performing a scan that includes two adjacent GND conversions (IADC_SCAN[n]_PORTPOS = IADC_SCAN[n]_PORTNEG = GND and IADC_SCAN[n + 1]_PORTPOS = IADC_SCAN[n + 1]_PORTNEG = GND) such that the configuration for one GND conversion differs from the other (e.g. IADC_SCAN[n]_CFG = 0 and IADC_SCAN[n + 1]_CFG = 1 or vice versa), the inputs for conversion [n + 2] in the sequence after the two GND conversions will not be selected.
<b>Affected Conditions / Impacts</b>
Results for the first conversion after two adjacent GND conversions in a scan will be erroneous.
<b>Workaround</b>
Do not perform scans that include two adjacent GND conversions.
<b>Resolution</b>
This issue is resolved in revision B devices.



## 4. Revision History

### Revision 0.2

April, 2019

- Added [GPIO\\_E302](#) and [HFXO\\_E301](#).

### Revision 0.1

January, 2019

- Initial release.

Silicon Labs

# Simplicity Studio™4



## Simplicity Studio

One-click access to MCU and wireless tools, documentation, software, source code libraries & more. Available for Windows, Mac and Linux!



**IoT Portfolio**  
[www.silabs.com/IoT](http://www.silabs.com/IoT)



**SW/HW**  
[www.silabs.com/simplicity](http://www.silabs.com/simplicity)



**Quality**  
[www.silabs.com/quality](http://www.silabs.com/quality)



**Support and Community**  
[community.silabs.com](http://community.silabs.com)

### Disclaimer

Silicon Labs intends to provide customers with the latest, accurate, and in-depth documentation of all peripherals and modules available for system and software implementers using or intending to use the Silicon Labs products. Characterization data, available modules and peripherals, memory sizes and memory addresses refer to each specific device, and "Typical" parameters provided can and do vary in different applications. Application examples described herein are for illustrative purposes only. Silicon Labs reserves the right to make changes without further notice to the product information, specifications, and descriptions herein, and does not give warranties as to the accuracy or completeness of the included information. Without prior notification, Silicon Labs may update product firmware during the manufacturing process for security or reliability reasons. Such changes will not alter the specifications or the performance of the product. Silicon Labs shall have no liability for the consequences of use of the information supplied in this document. This document does not imply or expressly grant any license to design or fabricate any integrated circuits. The products are not designed or authorized to be used within any FDA Class III devices, applications for which FDA premarket approval is required or Life Support Systems without the specific written consent of Silicon Labs. A "Life Support System" is any product or system intended to support or sustain life and/or health, which, if it fails, can be reasonably expected to result in significant personal injury or death. Silicon Labs products are not designed or authorized for military applications. Silicon Labs products shall under no circumstances be used in weapons of mass destruction including (but not limited to) nuclear, biological or chemical weapons, or missiles capable of delivering such weapons. Silicon Labs disclaims all express and implied warranties and shall not be responsible or liable for any injuries or damages related to use of a Silicon Labs product in such unauthorized applications.

### Trademark Information

Silicon Laboratories Inc.®, Silicon Laboratories®, Silicon Labs®, SiLabs® and the Silicon Labs logo®, Bluegiga®, Bluegiga Logo®, Clockbuilder®, CMEMS®, DSPLL®, EFM®, EFM32®, EFR®, Ember®, Energy Micro, Energy Micro logo and combinations thereof, "the world's most energy friendly microcontrollers", Ember®, EZLink®, EZRadio®, EZRadioPRO®, Gecko®, Gecko OS, Gecko OS Studio, ISOModem®, Precision32®, ProSLIC®, Simplicity Studio®, SiPHY®, Telegesis, the Telegesis Logo®, USBXpress®, Zentri, the Zentri logo and Zentri DMS, Z-Wave®, and others are trademarks or registered trademarks of Silicon Labs. ARM, CORTEX, Cortex-M3 and THUMB are trademarks or registered trademarks of ARM Holdings. Keil is a registered trademark of ARM Limited. Wi-Fi is a registered trademark of the Wi-Fi Alliance. All other products or brand names mentioned herein are trademarks of their respective holders.



**Silicon Laboratories Inc.**  
400 West Cesar Chavez  
Austin, TX 78701  
USA

<http://www.silabs.com>