



# EZR32 Happy Gecko

## EZR32HG Errata

---



This document contains information on the EZR32HG errata. The latest available revision of this device is revision C.

For errata on older revisions, refer to the errata history section for the device. The revision information is typically specified in or near the trace code on the device. Refer to the package marking information in the data sheet for more information.

Errata effective date: August 2019.

## 1. Active Errata Summary

These tables list all known errata for the EZR32HG and all unresolved errata in revision C of the EZR32HG.

**Table 1.1. Errata History Overview**

Designator	Title/Problem	Exists on Revision:	
		B	C
BOOT_E102	Bootloader Requires a Crystal	X	—
BOOT_E103	Documented Bootloader Pin Location	X	X
EMU_E107	Interrupts During EM2 Entry	X	X
EMU_E109	Potential Brown Out in EM2	X	—
EMU_E110	Potential Hard Fault when Exiting EM2 or EM3	X	—
EZR_E101	Latched RSSI Feature May Not Work Properly	X	X
EZR_E102	Increased Harmonics in TX Mode When Using a Direct Tie Match	X	X
EZR_E103	LDC Mode Duty Cycling May Stop After First Packet Reception	X	X
EZR_E104	Auto RX Frequency Hop May Stop Hopping	X	X
EZR_E105	TX to TX Transition Timing May Vary	X	X
EZR_E106	RX Lock-Up May Occur When DSA is Enabled	X	X
EZR_E107	Sync Word Detection Timeout for Non-Standard Preamble May Not Work	X	X
EZR_E108	Invalid Sync Word Hardware Interrupt Prematurely Fires When Antenna Diversity is Enabled	X	X
IDAC_E101	IDAC Output Current Degradation	X	X
PCNT_E102	PCNT Pulse Width Filtering Does Not Work	X	X
RMU_E102	Regulator Output May Be 0V After Supply Falls to Intermediate Voltage and Recovers	X	—
RMU_E103	Reset May Fail to Trigger During Supply Voltage Brownouts	X	—
USART_E113	IrDA Modulation and Transmission of PRS Input Data	X	X
USB_E111	Using EM2 with System Running on USHFRCO	X	X
USB_E112	SUSPEND in LEMOSCCTRL	X	X

Table 1.2. Active Errata Status Summary

Errata #	Designator	Title/Problem	Workaround Exists	Affected Revision	Resolution
1	BOOT_E103	Documented Bootloader Pin Location	Yes	C	Future data sheet revision
2	EMU_E107	Interrupts During EM2 Entry	Yes	C	—
3	EZR_E101	Latched RSSI Feature May Not Work Properly	Yes	C	—
4	EZR_E102	Increased Harmonics in TX Mode When Using a Direct Tie Match	Yes	C	—
5	EZR_E103	LDC Mode Duty Cycling May Stop After First Packet Reception	Yes	C	—
6	EZR_E104	Auto RX Frequency Hop May Stop Hopping	Yes	C	—
7	EZR_E105	TX to TX Transition Timing May Vary	Yes	C	—
8	EZR_E106	RX Lock-Up May Occur When DSA is Enabled	Yes	C	—
9	EZR_E107	Sync Word Detection Timeout for Non-Standard Preamble May Not Work	Yes	C	—
10	EZR_E108	Invalid Sync Word Hardware Interrupt Prematurely Fires When Antenna Diversity is Enabled	Yes	C	—
11	IDAC_E101	IDAC Output Current Degradation	Yes	C	—
12	PCNT_E102	PCNT Pulse Width Filtering Does Not Work	No	C	—
13	USART_E113	IrDA Modulation and Transmission of PRS Input Data	Yes	C	—
14	USB_E111	Using EM2 with System Running on USHFRCO	Yes	C	—
15	USB_E112	SUSPEND in LEMOSCCTRL	Yes	C	—

## 2. Detailed Errata Descriptions

### 2.1 BOOT\_E103 — Documented Bootloader Pin Location

<b>Description of Errata</b>
The revision 1.0 data sheet lists the bootloader pins (BOOT_TX and BOOT_RX) on PD6 (BOOT_TX) and PD7 (BOOT_RX). However, this is incorrect. The correct locations for these pins is PF0 (BOOT_TX) and PF1 (BOOT_RX).
<b>Affected Conditions / Impacts</b>
Systems attempting to use the bootloader by communicating on these pins will be unable to do so.
<b>Workaround</b>
If the hardware has been created for the incorrect pin locations, the bootloader can be updated to use these pins. The source code is in the example code zip file for <i>AN0042: USB/UART Bootloader</i> available at <a href="http://www.silabs.com/32bit-appnotes">http://www.silabs.com/32bit-appnotes</a> or in Simplicity Studio.
If the hardware has not yet been created, use the correct pins when creating the hardware.
<b>Resolution</b>
This issue will be resolved in a future revision of the data sheet.

### 2.2 EMU\_E107 — Interrupts During EM2 Entry

<b>Description of Errata</b>
An interrupt from a peripheral running from the high frequency clock that is received during EM2 entry will cause the EMU to ignore the SLEEPDEEP flag.
<b>Affected Conditions / Impacts</b>
During EM2 entry, the high frequency clocks that are disabled during EM2 will run for some clock cycles after WFI is issued to allow safe shutdown of the peripherals. If an enabled interrupt is requested from one of these non-EM2 peripherals during this shutdown period, the attempt to enter EM2 will fail, and the device will enter EM1 instead. As a result, the pending interrupt will immediately wake the device to EM0.
<b>Workaround</b>
Before entering EM2, disable all high frequency peripheral interrupts in the core.
<b>Resolution</b>
There is currently no resolution for this issue.

### 2.3 EZR\_E101 — Latched RSSI Feature May Not Work Properly

<b>Description of Errata</b>
The Latched RSSI may not be captured properly if the latching instant is based on Tbit/Tsample.
<b>Affected Conditions / Impacts</b>
The Latched RSSI may not be captured properly if the latching instant is based on Tbit/Tsample. In other words, when MODEM_RSSI_CONTROL: Latch = RX_STATE1-RX_STATE5, or MODEM_RSSI_CONTROL: AVERAGE = Sample1 the returned Latched RSSI may be invalid.
<b>Workaround</b>
Apply patch (Patch ID: 0x311A).
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

**2.4 EZR\_E102 — Increased Harmonics in TX Mode When Using a Direct Tie Match**

<b>Description of Errata</b>
In TX mode, harmonic content may be excessive due to incorrect LNA configuration when using a direct tie match. Increase of the 3rd harmonic can be as high as 20 dB.
<b>Affected Conditions / Impacts</b>
Increased harmonics levels in the TX spectrum. No impact when operating in RX state or when using a split TX / RX match or a match with an RF switch and single antenna. Both EZRadio and EZRadioPRO parts are affected.
<b>Workaround</b>
Apply patch (Patch ID: 0x311A).
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

**2.5 EZR\_E103 — LDC Mode Duty Cycling May Stop After First Packet Reception**

<b>Description of Errata</b>
When LDC (Low Duty Cycling) mode is enabled, the radio may stop receiving packets after the first successfully received packet.
<b>Affected Conditions / Impacts</b>
The chip may stop entering RX state autonomously. Only EZRadioPRO parts are affected.
<b>Workaround</b>
There are two workarounds available. <ol style="list-style-type: none"> <li>1. After reading the RX FIFO, enter Sleep state.</li> <li>2. Apply patch (Patch ID: 0x311A).</li> </ol>
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

**2.6 EZR\_E104 — Auto RX Frequency Hop May Stop Hopping**

<b>Description of Errata</b>
Without any signal present, the radio may stop hopping after a while and stay in receive mode at a seemingly random channel.
<b>Affected Conditions / Impacts</b>
Automatic frequency hopping may stop working. The device is still functional and will respond to subsequent commands from the host. Only EZRadioPRO parts are affected.
<b>Workaround</b>
Apply patch (Patch ID: 0x311A).
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

## 2.7 EZR\_E105 — TX to TX Transition Timing May Vary

<b>Description of Errata</b>
RevC2A chips support TX to TX state transitions, however, the amount of time it takes to do so may be inconsistent.
<b>Affected Conditions / Impacts</b>
TX to TX state transition time may vary. Both EZRadio and EZRadioPRO parts are affected. This does not affect the manual TX_HOP timing.
<b>Workaround</b>
Apply patch (Patch ID: 0x311A).
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

## 2.8 EZR\_E106 — RX Lock-Up May Occur When DSA is Enabled

<b>Description of Errata</b>
RevC2A chips have a new block, Digital Signal Arrival detector (DSA), which can be used to detect preamble in a very short period of time. The DSA is used for Preamble Sense Mode (PSM) amongst other features, where the chip duty cycles between RX Idle and RX state while searching for a preamble. When the DSA is enabled an RX lock-up may occur.
<b>Affected Conditions / Impacts</b>
RX lock-up may occur. The device is still functional and will respond to subsequent commands from the host. Only EZRadioPRO parts are affected.
<b>Workaround</b>
Apply patch (Patch ID: 0x311A).
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

## 2.9 EZR\_E107 — Sync Word Detection Timeout for Non-Standard Preamble May Not Work

<b>Description of Errata</b>
It is possible to configure the device for non-standard preamble (i.e. other than a 1010, or a 0101 pattern), in which case the sync word timeout is controlled by the packet handler. When this feature is enabled, the sync word detection timeout may not work correctly.
<b>Affected Conditions / Impacts</b>
Without a sync word timeout, the chip may continue searching for a sync word instead of going back to searching for non-standard preamble. No impact if standard preamble is used. Only EZRadioPRO parts are affected.
<b>Workaround</b>
Apply patch (Patch ID: 0x311A).
<b>Resolution</b>
Apply the patch (Patch ID: 0x311A) to resolve this problem.

**2.10 EZR\_E108 — Invalid Sync Word Hardware Interrupt Prematurely Fires When Antenna Diversity is Enabled**

<b>Description of Errata</b>
If Invalid Sync Word hardware interrupt is enabled, it may fire right after PREAMBLE_VALID signal without receiving enough number of bits to determine whether or not there is a Sync Word pattern match.
<b>Affected Conditions / Impacts</b>
Invalid Sync Word detect NIRQ hardware interrupt cannot be used when Antenna Diversity is enabled. Only EZRadioPRO parts are affected.
<b>Workaround</b>
Disable Invalid Sync Word detect NIRQ hardware interrupt when Antenna Diversity is enabled.
<b>Resolution</b>
There is currently no resolution for this issue.

**2.11 IDAC\_E101 — IDAC Output Current Degradation**

<b>Description of Errata</b>
The current output of the IDAC might degrade over time.
<b>Affected Conditions / Impacts</b>
Due to an undefined shut-down state of the IDAC, powered devices that do not use the IDAC continuously might experience some degradation in the current output over the lifetime of the device. The degradation is very small when the device is used at room temperature, but the output current will fall well outside specs if the device is exposed to higher temperatures for longer periods of time.
<b>Workaround</b>
If the IDAC output current stability is crucial to the application, the IDAC should never be completely disabled while the device is powered. Leaving the IDAC enabled in the lowest output code setting with duty-cycling enabled consumes ~50 nA extra current and eliminates the problem.
<b>Resolution</b>
There is currently no resolution for this issue.

**2.12 PCNT\_E102 — PCNT Pulse Width Filtering Does Not Work**

<b>Description of Errata</b>
PCNT pulse width filtering does not work.
<b>Affected Conditions / Impacts</b>
The PCNT pulse width filter does not work as intended.
<b>Workaround</b>
Do not use the pulse width filter, i.e. ensure FILT = 0 in PCNTn_CTRL.
<b>Resolution</b>
There is currently no resolution for this issue.

**2.13 USART\_E113 — IrDA Modulation and Transmission of PRS Input Data**

<b>Description of Errata</b>
If the USART IrDA modulator is configured to accept input from a PRS channel, the incoming data stream will not be transmitted because the required clock from the baud rate generator is never enabled.
<b>Affected Conditions / Impacts</b>
It is not possible for the USART IrDA modulator to directly transmit data from a source other than the USART's own transmitter. The USART_IRCTRL_IRPRSEN bit should remain at its reset state of 0.
<b>Workaround</b>
Assuming the data to be sent via the PRS is also data that could be received by the EFM32/EFR32 USART, then the data can be received using the USART's PRS RX feature (USART_INPUT_RXPRS = 1), stored in RAM (e.g. using DMA), and then transmitted with IrDA mode enabled. In cases where IrDA operation is transmit-only, the PRS RX data can be received on the same USART doing the transmission. If IrDA operation is bidirectional, then another USART must be used to receive the PRS data.  If the data to be sent is in some other format (e.g. pulses from a timer output), then there is no direct way to transmit it using the IrDA modulator. It would be necessary to capture the data in some other way and reformat it as serial data timed according to the clock generated by the USART.
<b>Resolution</b>
There is currently no resolution for this issue.

**2.14 USB\_E111 — Using EM2 with System Running on USHFRCO**

<b>Description of Errata</b>
Running the system on USHFRCO will not work with EM2 in USB applications.
<b>Affected Conditions / Impacts</b>
Entering EM2 when both the system clock (HFCLK) and the USB core clock (USBCCLK) are running on USHFRCO will result in a lock-up.
<b>Workaround</b>
Use either HFRCO or HFXO for the system clock (HFCLK) if EM2 is employed in USB applications. Alternatively, the EMVREG bit in EMU_CTRL can be set. This allows EM2 to be used at the cost of extra current consumption in EM2.
<b>Resolution</b>
There is currently no resolution for this issue.

**2.15 USB\_E112 — SUSPEND in LEMOSCCTRL**

<b>Description of Errata</b>
Do not use the SUSPEND mode of LEMOSCCTRL in USB_CTRL.
<b>Affected Conditions / Impacts</b>
In rare cases with high data throughput, a transmission can fail when this mode is enabled.
<b>Workaround</b>
Use the GATED mode of LEMOSCCTRL for the best energy efficiency. The NONE mode can be used to disable energy savings.
<b>Resolution</b>
There is currently no resolution for this issue.



### 3. Errata History

This section contains the errata history for EZR32HG devices.

For errata on the latest revision, refer to the beginning of this document. The device data sheet explains how to identify chip revision, either from package marking or electronically.

#### 3.1 Errata History Summary

This table lists all resolved errata for the EZR32HG.

**Table 3.1. Errata History Status Summary**

Errata #	Designator	Title/Problem	Workaround Exists	Affected Revision	Resolution
1	BOOT_E102	<a href="#">Bootloader Requires a Crystal</a>	Yes	B	B devices (date code $\geq$ 1801)
2	EMU_E109	<a href="#">Potential Brown Out in EM2</a>	Yes	B	B devices (date code 1618 and PROD_REV $\geq$ 0x81)
3	EMU_E110	<a href="#">Potential Hard Fault when Exiting EM2 or EM3</a>	Yes	B	B devices (date code $\geq$ 1801)
4	RMU_E102	<a href="#">Regulator Output May Be 0V After Supply Falls to Intermediate Voltage and Recovers</a>	Yes	B	C
5	RMU_E103	<a href="#">Reset May Fail to Trigger During Supply Voltage Brownouts</a>	Yes	B	C

#### 3.2 Detailed Errata Descriptions

##### 3.2.1 BOOT\_E102 — Bootloader Requires a Crystal

<b>Description of Errata</b>
<p>Versions of the production bootloader prior to v2.06 require a crystal. All devices with the affected date codes use a version of the bootloader prior to v2.06 and will require a crystal to use the production bootloader.</p> <p>Version 2.06 of the bootloader will be updated to no longer require a crystal, since one is not needed on these products.</p>
<b>Affected Conditions / Impacts</b>
<p>Systems intending to use versions older than v2.06 of the production bootloader that do not include a crystal will not be able to run the bootloader on affected devices.</p>
<b>Workaround</b>
<p>For systems intending to use the production bootloader on affected devices, add a temporary crystal to the design that can later be removed when it's no longer needed.</p>
<b>Resolution</b>
<p>This issue has been resolved. Devices with a date code greater than or equal to 1801 will not have this issue.</p>

### 3.2.2 EMU\_E109 — Potential Brown Out in EM2

<b>Description of Errata</b>
There is an error with the calibration algorithm for a voltage regulator that is active during EM2 mode.
<b>Affected Conditions / Impacts</b>
There is an error with the calibration algorithm for a voltage regulator that is active during EM2 mode. This error can, in rare instances, cause the device to brown out and reset while operating in EM2 mode.
<b>Workaround</b>
<p>The issue has been corrected with an updated and validated test program. Devices with a date code greater than or equal to 1618 have been tested with the corrected test program.</p> <p>Firmware can also work around this issue by writing the calibration value for the low current regulator active in EM2 to 0x6 after any reset or wakeup from EM4. More information on this firmware workaround including example code can be found at the following KB article URL:</p> <p><a href="https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2016/11/04/emu_e109_-_potential-gBa3">https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2016/11/04/emu_e109_-_potential-gBa3</a></p>
<b>Resolution</b>
The issue has been corrected with an updated and validated test program. Devices with a date code and PROD_REV greater than or equal to 1618 and 0x81 respectively have been tested with the corrected test program.

### 3.2.3 EMU\_E110 — Potential Hard Fault when Exiting EM2 or EM3

<b>Description of Errata</b>
The flash is powered down in EM2 and EM3 to save power. Some control registers in the flash can rarely enter an invalid state upon power-on, causing the first read of flash to be incorrect. If this occurs after exiting EM2 or EM3, the core attempts to fetch the interrupt address, but the value will be incorrect and may be invalid. In the case of an invalid value, the core will then jump to the hard fault handler for attempting to execute code from an invalid address. All subsequent reads from the flash are unaffected, and it is only the first flash read after exit from EM2 or EM3 that is potentially erroneous.
<b>Affected Conditions / Impacts</b>
When exiting EM2 or EM3, some devices may intermittently execute code incorrectly or enter the hard fault handler instead of entering the expected ISR associated with the wake source.
<b>Workaround</b>
<p>To workaround this issue, move the interrupt vector table and interrupt service routines for EM2 or EM3 wake sources to RAM and perform a dummy read of the flash in the ISR. Additional information on the workaround and examples provided is available from the following Knowledge Base article URL:</p> <p><a href="https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2017/05/09/emu_e110_-_potential-i2Pn">https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2017/05/09/emu_e110_-_potential-i2Pn</a></p>
<b>Resolution</b>
This issue has been resolved. Devices with a date code greater than or equal to 1801 will not have this issue.

**3.2.4 RMU\_E102 — Regulator Output May Be 0V After Supply Falls to Intermediate Voltage and Recovers**

<b>Description of Errata</b>
Output of the on-chip regulator (DECOUPLE pin) may be approximately 0V, and the device will not respond to a pin reset.
<b>Affected Conditions / Impacts</b>
<p>The device supply voltage is specified as 1.98V minimum. For certain supply waveforms, similar to disconnecting a battery, allowing the supply to decay to approximately 0.9V (and stopping the decay at approximately 0.9V), then reconnecting the battery, the output of the regulator (DECOUPLE pin) may be approximately 0V. In this state, code will not execute, and the device will not respond to a pin reset. More information on this issue can be found at the following KB article URL:</p> <p><a href="https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2019/01/09/rmu_e102_por_bodres-AQh7">https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2019/01/09/rmu_e102_por_bodres-AQh7</a></p>
<b>Workaround</b>
Hold the RESETn pin logic low, starting before the supply is disconnected, and keep RESETn pin logic low until the supply reaches a valid voltage. If the DECOUPLE pin measures approximately 0V, power cycle the supplies by pulling them all the way to 0V before connecting supplies again.
<b>Resolution</b>
This issue is resolved in revision C devices.

**3.2.5 RMU\_E103 — Reset May Fail to Trigger During Supply Voltage Brownouts**

<b>Description of Errata</b>
Reset may fail to trigger when the device supplies (AVDD_0, AVDD_2, VDD_DREG) fall to a voltage in the 1.25V - 1.45V range.
<b>Affected Conditions / Impacts</b>
<p>If the device supplies (AVDD_0, AVDD_2, VDD_DREG) fall to a voltage in the 1.25V - 1.45V range, the device may fail to reset, allowing code execution while the supply voltage remains in the 1.25V - 1.45V range. More information on this issue can be found at the following KB article URL:</p> <p><a href="https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2019/01/09/rmu_e103_por_bodres-N3MD">https://www.silabs.com/community/mcu/32-bit/knowledge-base.entry.html/2019/01/09/rmu_e103_por_bodres-N3MD</a></p>
<b>Workaround</b>
Hold the RESETn pin in logic low, starting before the device supplies fall below 1.6V, and keep the RESETn pin logic low until the device supplies reach a valid voltage again.
<b>Resolution</b>
This issue is resolved in revision C devices.

## 4. Revision History

### Revision 1.5

August, 2019

- Changed current device revision to revision C.
- [BOOT\\_E102](#), [EMU\\_E109](#), [EMU\\_E110](#), [RMU\\_E102](#) and [RMU\\_E103](#) resolved and moved to [3. Errata History](#).

### Revision 1.40

January, 2019

- Added [EMU\\_E107](#), [RMU\\_E102](#), [RMU\\_E103](#), and [USART\\_E113](#).
- Resolved [BOOT\\_E102](#) and [EMU\\_E110](#).
- Resolution date code for [BOOT\\_E102](#) and [EMU\\_E110](#) changed from 1751 to 1801 to align with EFM32 Happy Gecko.
- [EMU\\_E109](#) workaround URL updated.

### Revision 1.31

January, 2017

- Updated [BOOT\\_E102](#) and [EMU\\_E110](#) resolution text.
- Updated revision history format.

### Revision 1.30

October, 2017

- Updated [EMU\\_E110](#) to refer to both EM2 and EM3.
- Added [BOOT\\_E102](#) and [BOOT\\_E103](#).

### Revision 1.20

April, 2017

- Added [EMU\\_E110](#).
- Updated errata formatting.
- Merged all errata documents for EZ32HG devices into one document.
- Merged errata history and errata into one document.

### Revision 1.10

August, 2016

- Added [EMU\\_E109](#).


### Revision 1.00

April, 2016

- Initial preliminary release.

Silicon Labs

# Simplicity Studio™4

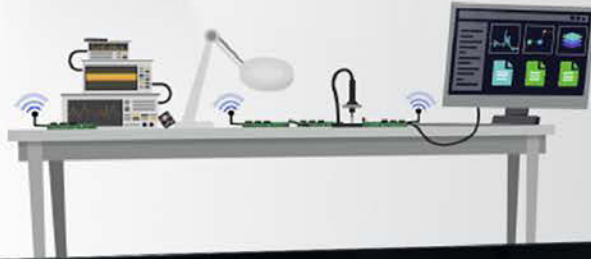

## Simplicity Studio

One-click access to MCU and wireless tools, documentation, software, source code libraries & more. Available for Windows, Mac and Linux!



**IoT Portfolio**  
[www.silabs.com/IoT](http://www.silabs.com/IoT)



**SW/HW**  
[www.silabs.com/simplicity](http://www.silabs.com/simplicity)



**Quality**  
[www.silabs.com/quality](http://www.silabs.com/quality)



**Support and Community**  
[community.silabs.com](http://community.silabs.com)

### Disclaimer

Silicon Labs intends to provide customers with the latest, accurate, and in-depth documentation of all peripherals and modules available for system and software implementers using or intending to use the Silicon Labs products. Characterization data, available modules and peripherals, memory sizes and memory addresses refer to each specific device, and "Typical" parameters provided can and do vary in different applications. Application examples described herein are for illustrative purposes only. Silicon Labs reserves the right to make changes without further notice to the product information, specifications, and descriptions herein, and does not give warranties as to the accuracy or completeness of the included information. Without prior notification, Silicon Labs may update product firmware during the manufacturing process for security or reliability reasons. Such changes will not alter the specifications or the performance of the product. Silicon Labs shall have no liability for the consequences of use of the information supplied in this document. This document does not imply or expressly grant any license to design or fabricate any integrated circuits. The products are not designed or authorized to be used within any FDA Class III devices, applications for which FDA premarket approval is required or Life Support Systems without the specific written consent of Silicon Labs. A "Life Support System" is any product or system intended to support or sustain life and/or health, which, if it fails, can be reasonably expected to result in significant personal injury or death. Silicon Labs products are not designed or authorized for military applications. Silicon Labs products shall under no circumstances be used in weapons of mass destruction including (but not limited to) nuclear, biological or chemical weapons, or missiles capable of delivering such weapons. Silicon Labs disclaims all express and implied warranties and shall not be responsible or liable for any injuries or damages related to use of a Silicon Labs product in such unauthorized applications.

### Trademark Information

Silicon Laboratories Inc.®, Silicon Laboratories®, Silicon Labs®, SiLabs® and the Silicon Labs logo®, Bluegiga®, Bluegiga Logo®, Clockbuilder®, CMEMS®, DSPLL®, EFM®, EFM32®, EFR®, Ember®, Energy Micro, Energy Micro logo and combinations thereof, "the world's most energy friendly microcontrollers", Ember®, EZLink®, EZRadio®, EZRadioPRO®, Gecko®, Gecko OS, Gecko OS Studio, ISOModem®, Precision32®, ProSLIC®, Simplicity Studio®, SiPHY®, Telegesis, the Telegesis Logo®, USBXpress®, Zentri, the Zentri logo and Zentri DMS, Z-Wave®, and others are trademarks or registered trademarks of Silicon Labs. ARM, CORTEX, Cortex-M3 and THUMB are trademarks or registered trademarks of ARM Holdings. Keil is a registered trademark of ARM Limited. Wi-Fi is a registered trademark of the Wi-Fi Alliance. All other products or brand names mentioned herein are trademarks of their respective holders.



**Silicon Laboratories Inc.**  
400 West Cesar Chavez  
Austin, TX 78701  
USA

<http://www.silabs.com>